

## IPMI Firmware Release Notes Form

*Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.*

<b>Product Name</b>	<b>H12DSG-O-CPU</b>
<b>Release Version</b>	<b>1.00.35</b>
<b>Build Date</b>	<b>6/03/2021</b>
<b>Previous Version</b>	<b>1.00.33</b>
<b>Update Category</b>	<b>Recommended</b>
<b>Dependencies</b>	<b>BIOS 2.0 or above</b>
<b>Important Notes</b>	IPMI Image: BMC_H12AST2500_ROT_B101MS_20210603_01.00.35_sp.bin IPMI Update Package: BMC_H12AST2500_ROT_B101MS_20210603_01.00.35_sp.ZIP
<b>Enhancements</b>	1. Added support for GPU NVIDIA A40 & A10.
<b>New features</b>	N/A
<b>Fixes</b>	N/A

## ***Release Notes from Previous Release(s)***

### ***1.00.33 (2/23/2021)***

1. Fixed inability of NVMe device to display correct information to user.
2. Fixed issue with finding IPMI SDR reading AOC\_NIC name after updating IPMI firmware v1.00.32.

### ***1.00.32 (1/29/2021)***

1. Added GPU fan control for PCIe board.
2. Added support for getting HBM temperature for AMD GPU MI100 A2.
3. Fixed problem of system throttling when only one PSU is present.
4. Fixed failure to receive de-assertion event while plugging in the FAN cable on the H12SSWNTR and x12spz works.
5. Fixed problem of system sometimes getting "CPU1 Temp - Processor automatically throttled - Assertion".
6. Fixed inability of user to log in after setting up IPMI login password with "\" character.
7. Fixed problem of IPMI WebGUI getting error message from NVMe device during DC on/off testing.
8. Fixed problem of Alert LED blinking after power state is recovered.
9. Fixed delay in detecting FAN failure when FAN connector is disconnected.
10. Fixed delay in triggering Alert LED when IPMI detects power failure.
11. Fixed error when reading temperature for AMD MI100 A2.
12. Fixed failure of UKVM on the some RoT projects.

### ***1.00.20 (9/16/2020)***

1. Updated MI50 GPU threshold (UNC:95, UC:100, UNR:110).
2. Adjusted the threshold of VDDCR from UNC to 1.575, UCR to 1.732, and UNR to 1.811.
3. Fixed problem of TDP Watts showing as 0 on Component Info - CPU page.
4. Fixed failure of IPMIECO Automation test.
5. Fixed problem of the system state staying critical when the power is off and failure of the format to follow SPEC on Component Info page.
6. Fixed problem of login page showing "Browser not support" even when using Chrome.
7. Fixed failure of SUT to power on automatically after "-c BiosRotManage --action UpdateGolden --reboot" process completes.
8. Fixed problem of sensor status showing as critical while system status and sensor reading are normal.
9. Fixed failure of some items on some pages to translate into Japanese and Simplified Chinese.
10. Fixed mismatch of the format of Inventory page and latest SPEC.
11. Fixed inability to update BIOS through BMC WebUI.
12. Fixed inability to use remote console function.
13. Fixed failure of NVMe SSD eject function in IPMI WebGUI.
14. Fixed inability of H12DSG BMC firmware 1.0.6 to recover unique password by command 0x30 0x40.
15. Fixed missing motherboard CPLD version on IPMI WebGUI dashboard.
16. Fixed problem of NVMe ejecting randomly during IPMI on/off test.
17. Fixed failure of IPMI execution when running IPMI ECO Automation.
18. Corrected display of popup message.

### ***1.00.06 (6/5/2020)***

Initial Release