

IPMI Firmware / BIOS Release Notes Form

Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.

Product Name	H13SSL-N/NT
Release Version	01.01.08
Release Date	10/06/2023
Build Date	10/06/2023
Previous Version	01.01.03
Update Category	Recommend
Dependencies	BIOS Rev. 1.6
Important Notes	ECO #29010 BMC_H13AST2600-ROT-1401MS_20231006_01.01.08_STDsp.bin Please update IPMI with attached Flash Utility in package. If the IPMI firmware revision is earlier than 01.01.01, please do not select the "Preserve" check box during IPMI firmware update.
Enhancements	<ol style="list-style-type: none"> 1. Support IPv6 enhancement spec. (Proposal for BIOS-BMC IPv6 inconsistency_V11.pptx) 2. Update AMD RAS crash dump to ADDC 1.8 3. [156498] ECO -- 21603 -- 01.00.18 -- [MEL] should non-set IPv4 DNS Server IP related MEL be shown when setup IPv6 DNS Server IP or not 4. [162843] [IPMI 1.01.05 ECO] IPMI display "PCIE PERR error" when inject memory UECC [162842] [IPMI 1.01.05 ECO] IPMI display incorrect location when inject memory CECC [151917] [AMD RAS][CH6] No show OS error log when execute "GMI3/xGMI3 Error Injection"
New features	N/A
Fixes	<ol style="list-style-type: none"> 1. Fixes Current owner index is wrong after RA provision 2. fixes MEL-0135 displays more than 3 times 3. Fixes BMC cannot obtain IP 4. Fixes [163528] ECO — 21603 — 01.01.07(09/22/2023) — [SUM] — IPv4 DNS setting comparison wasn't the same after executing "ChangeBmcCfg" command via SUM [163845] ECO — 21603 — 01.01.07(09/22/2023) — [SUM] — IPv4 DNS setting comparison wasn't the same after executing "ChangeBmcCfg" command via SUM 5. Fixes [163529] ECO — 21603 — 01.01.07(09/22/2023) — [MEL] — No related MEL when disable TSIG Authentication 6. [162844] STD -- 21603 -- 01.01.05 (2023/09/08) -- WEB -- MEL is incorrect after do ikvm reset 7. [162823] ECO -- 21603 -- 01.01.05 -- Remote Console Preview current interface button enabled 8. [160509] ECO — 21603 — 01.01.01(07/21/2023) — [MEL] — should non-set IPv4 DNS Server IP related MEL be shown when setup Hostname or not 9. [162260] ECO -- 21603 -- 01.01.03 -- SNMP(User) Auth/Private Key naming not match with MEL 10. [162262] ECO -- 21603 -- 01.01.03 -- [GUI] Password can't be reverse of the User name, error return "Oops! Something went wrong." not quit match with the situation 11.[162263] ECO -- 21603 -- 01.01.03 -- SNMPv3(Alert) Authentication/Encryption Protocol naming not match with MEL 12. Fix OTP flush error and should stop provision 13. [159725] [RoT] Update CPLD Golden image event log timestamp is incorrect 14. [160511] ECO -- 21603 -- 01.01.01(07/21/2023) -- Could not mount ISO via SMCIPMITool when Virtual Media does not mount any ISO or floppy

Release Notes from Previous Release(s) – these will be appended at the bottom of the current release notes in italic and in smaller print

01.00.18 (04/27/2023)

1. Fix boot exception
2. Fix Sensor naming to match with spec
3. Fix Chassis intrusion Reset button does not gray out when System Lockdown Mode is ON
4. Fine-tune I3C clock parameters, and make to be compatible with more DIMM models

01.00.14 (02/10/2023)

1. Enable IPMB
2. fixes read incorrect Power Status without AMD CPU in H13 Platform

01.00.09 (12/05/2022)

1. Improve the problem of SMBUS reading and writing NIC card

01.00.06 (11/15/2022) First release